CO-A4 Carbon Monoxide Sensor
4-Electrode

Technical Specification

PATENTED

Figure 1 CO-A4 Schematic Diagram

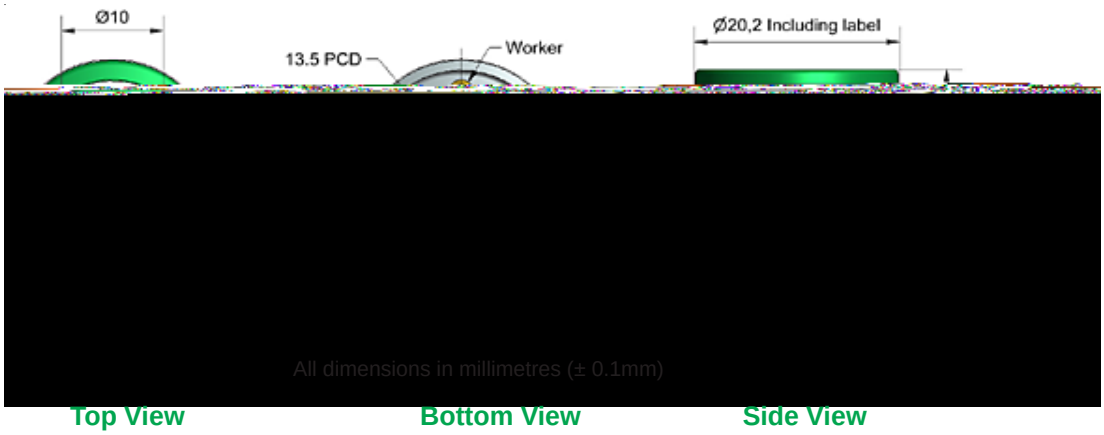

PERFORMANCE	Sensitivity	nA/ppm in 2ppm CO	220 to 375
	Response time	t_{90} (s) from zero to 10ppm CO	< 20
	Zero current	nA in zero air at 20°C	-100 to +10
	Noise*	±2 standard deviations (ppb equivalent)	20
	Range	ppm limit of performance warranty	500
	Linearity	ppm CO error at full scale, linear at zero, 15ppm CO	< ± 1
	Overgas limit	maximum ppm for stable response to gas pulse	2000

*** Tested with Alphasense AFE low noise circuit**

LIFETIME	Zero drift	ppb equivalent change/year in lab air	< ±100
	Sensitivity drift	% change/year in lab air, monthly test	< 10
	Operating life	months until 50% original signal (24 month warranted)	> 36

ENVIRONMENTAL	Sensitivity @ -20°C	(% output @ -20°C/output @ 20°C) @ 5ppm CO	50 to 85
	Sensitivity @ 50°C	(% output @ 50°C/output @ 20°C) @ 5ppm CO	110 to 125
	Zero @ -20°C	nA change from 20°C	10 to 40
	Zero @ 50°C	nA change from 20°C	-120 to -200

CROSS SENSITIVITY

Filter capacity	ppm·hrs		H_2S	250,000
H_2S sensitivity	% measured gas @	5ppm	H_2S	< 0.1
NO_2 sensitivity	% measured gas @	5ppm	NO_2	< -2
Cl_2 sensitivity	% measured gas @	5ppm	Cl_2	< 0.1
NO sensitivity	% measured gas @	5ppm	NO	< -2
SO_2 sensitivity	% measured gas @	5ppm	SO_2	< 0.1
H_2 sensitivity	% measured gas @	100ppm	H_2 at 20°C	< 10
C_2H_4 sensitivity	% measured gas @	100ppm	C_2H_4	< 0.5
NH_3 sensitivity	% measured gas @	20ppm	NH_3	< 0.1

KEY SPECIFICATIONS	Temperature range	°C	-30 to 50
	Pressure range	kPa	80 to 120
	Humidity range	% rh continuous	15 to 90
	Storage period	months @ 3 to 20°C (stored in sealed pot)	6
	Load resistor	(AFE circuit is recommended)	33 to 100
	Weight	g	< 6

At the end of the product's life, do not dispose of any electronic sensor, component or instrument in the domestic waste, but contact the instrument manufacturer, Alphasense or its distributor for disposal instructions.

NOTE: all sensors are tested at ambient environmental conditions, with 10 ohm load resistor, unless otherwise stated. As applications of use are outside our control, the information provided is given without legal responsibility. Customers should test under their own conditions, to ensure that the sensors are suitable for their own requirements.

Alphasense Ltd, Sensor Technology House, 300 Avenue West, Skyline 120, Great Notley. CM77 7AA. UK
Telephone: +44 (0) 1376 556 700 Fax: +44 (0) 1376 335 899 E-mail: sensors@alphasense.com Website: www.alphasense.com